

**Site Specific Design, Inc.**

**1704 Rockwell Road  
Abington, PA 19001  
215-887-3730**

**Invoice**

Date	Invoice #
8/26/2022	66591

Bill To
Middletown Township Sewer Authority 27 N Pennel Road PO Box 157 Lima, PA 19037-0157

Ship To
Middletown Township c/o Dan Herzog 25 Dartmouth Circle Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via	Ref #	Project
	30 Days	JoeS	8/11/2022			

Qty	Item Code	Description	Price Each	Amount
		Replace DH298708 & DH298709 with new pumps DH803815 & DH805403 Middletown Township c/o Dan Herzog 25 Dartmouth Circle Media, PA 19063  8/10/22 Pat Arrived on site and found the copper discharge to pump DH298708 with two blown holes in it pulled pump to bring back to the shop for evaluation/repair. it's a Duplex system. Pump two is running as it should.  8/25/22 Dh298708 Inspected pump at shop. Control housing heavily degraded and bolt assembly holes completely worn away, housing is no longer useable. Motor housing also heavily degraded and bolt holes worn away as well. Bearings worn out, stator and cutter wheel worn out. Pump supply cable failed and needs to be replaced. Check valve attachments cracked and broken, check valve also needs to be replaced. Every part on pump is essentially failed and requires replacement. Cost of rebuild pump is virtually the same as buying new core. Recommend installing new core with warranty instead of entirely rebuild pump part for part.  8/26/22 Pat		
All material remains the property of Site Specific Design until final payment.			<b>Total</b>	

**Site Specific Design, Inc.**

**1704 Rockwell Road  
Abington, PA 19001  
215-887-3730**

**Invoice**

Date	Invoice #
8/26/2022	66591

Bill To
Middletown Township Sewer Authority 27 N Pennel Road PO Box 157 Lima, PA 19037-0157

Ship To
Middletown Township c/o Dan Herzog 25 Dartmouth Circle Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via	Ref #	Project
	30 Days	JoeS	8/11/2022			

Qty	Item Code	Description	Price Each	Amount
		Arrived on site to install new core DH803815 and to check pump DH298709. Pulled pump DH298709 for further evaluation and found the pump was heavily corroded and control housing bolt holes are corroded through. Installed new core DH805403 and DH803815 cycled both pumps they go into and out of alarm and from on/off 34 seconds at 5.9 and 6.0 amps pumps are running correctly.		
2	Misc40700	DH071-93 50' Standard Cover Configuration 240V 7' core Candy Cane discharge extreme cutter wheel DH803815, DH805403	0.00	0.00
2	Installation of Ne...	Installation of new Extreme Core w/2 yr warranty. Inspect installation, basin, valve and alarm panel. Inspect EQD & wiring. Remove old pump, identify cause of failure, if possible. Provide warranty documentation. Clean grease and debris accumulation in basin. Install new pump core and test, record performance. Dispose of old components and clean work area.	3,450.00	6,900.00
1	Misc40700	Misc parts needed for service	100.00	100.00
All material remains the property of Site Specific Design until final payment.			<b>Total</b>	<b>\$7,000.00</b>

Returned checks will incur a \$25.00 surcharge. If at any time your account runs past due, all shipments may be held pending.