

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001
(215) 887-3730



Invoice

Date	Invoice #
11/21/2023	72597

Bill To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063

Ship To
Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via		Project
	Net 30	PB	10/31/2023			

Qty	Item Code	Description	Price Each	Amount
		DNR DH511681 New twp pump DH870182 Mike Maroulis (Upper Prov) 101 West Rose Tree Road Media, PA 19063 Date of service 10/31/23 Technician Pat Brady Arrived on site and found pump DH511681 in high level alarm and not pumping out all meter readings were incorrect pulled pump for further evaluation and found station was full of grease .Cleaned out station the best I could and installed site spare and bringing back pump DH511681 to shop for further evaluation/repair. Spare DH623206 has been installed and cycled pump goes into and out of alarm and from on/off 30 seconds at 6.4 amps pump is running correctly ESTIMATE 11/09/23 Determined that pump DH511681 switches are corroded. The control clip is the old style. The motor megs good but the bearings are starting to make noise. The stator is worn from a run dry occurrence and the cutter teeth are worn. Also found cloth like fabrics around the mechanical seal.		

**OK TO PAY
KEVIN MATSON, PE,
OPERATIONS MANAGER**


12/04/2023

All material remains the property of Site Specific Design until final payment.

Subtotal

Sales Tax (0.0%)

Total

Payments/Credits

Total Due

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001
(215) 887-3730



Invoice

Date	Invoice #
11/21/2023	72597

Bill To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063

Ship To
Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via		Project
	Net 30	PB	10/31/2023			

Qty	Item Code	Description	Price Each	Amount
		Update: It was found the motor was damaged from the bearings becoming loose inside the motor itself. This deems the motor not reusable. This pump will require a full rebuild, or be replaced with a new core. 11/21/23 Pat Arrived on site to install a new upper providence core DH870182. Pulled sites spare DH623206 installed new core pump goes into and out of alarm and from on/off 32 seconds at 6.1 amps pump is running correctly		
1	Service/Ins	Service Call & Inspection Fee <	150.00	150.00
2	Labor-BM	Shop Labor-Brandon M	120.00	240.00
1	Labor-JS	Shop Labor rate for John Simons	120.00	120.00
1	Labor-PB	Field Labor rate for Pat	120.00	120.00

All material remains the property of Site Specific Design until final payment.

Subtotal \$630.00

Sales Tax (0.0%) \$0.00

Total \$630.00

Payments/Credits \$0.00

Total Due \$630.00

Returned checks will incur a \$25.00 surcharge. If at any time your account runs past due, all shipments may be held pending.