

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001



Invoice

215-887-3730

Date	Invoice #
3/4/2025	79448

Bill To	Ship To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063	Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via		Project
	Net 30	AD	3/4/2025			
Qty	Item Code	Description			Price Each	Amount
1	UD200A01A01AA	Replace DH385774 with new pump DH935983 Jude Pazulski (Upper Prov) 440 Sycamore Mills Rd Media, Pennsylvania 19063-2032 Date of service 3/4/25 Technician Sebastian Gonzalez Arrive on site to find panel in alarm. Performed meter readings and all readings to pump were bad except voltage from pump to panel 240v switches were giving off high numbers and I wasn't getting any amp draws. I lifted lid to station to find station flooded. I pulled pump DH385774 and saw that pump was from 09/2010. I replaced with new core on truck DH00935983 I installed new pump into station and I ran pump out of alarm and I also had customer run water for me so I run pump to its normal cycle both times everything checked out. I also megged cables to panel to make sure everything is running correctly and readings came back good. Job completed.			0.00	0.00


Subtotal

Sales Tax (0.0%)

Total

Payments/Credits

Total Due

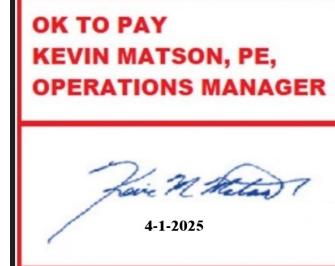

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001



Invoice

215-887-3730

Date	Invoice #
3/4/2025	79448

Bill To	Ship To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063	Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via		Project
	Net 30	AD	3/4/2025			
Qty	Item Code	Description			Price Each	Amount
1	Installation of Ne...	Installation of new Extreme Core w/2 yr warranty. Inspect installation, basin, valve and alarm panel. Inspect EQD & wiring. Remove old pump, identify cause of failure, if possible. Provide warranty documentation. Clean grease and debris accumulation in basin. Install new pump core and test, record performance. Dispose of old components and clean work area.			3,205.00	3,205.00

Subtotal	\$3,205.00
Sales Tax (0.0%)	\$0.00
Total	\$3,205.00
Payments/Credits	\$0.00
Total Due	\$3,205.00

Returned checks will incur a \$25.00 surcharge. If at any time your account runs past due, all shipments may be held pending.