

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001



Invoice


215-887-3730

Date	Invoice #
12/16/2025	83869

Bill To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063

Ship To
Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via	Project
	Net 30	BB	12/16/2025		
Qty	Item Code	Description		Price Each	Amount
		Repair DH507297 Jim Karalis (Upper Prov) 105 Water Mill Ln Media, Pennsylvania 19063-1815 Date of service 12/16/25 Technician Bryan Beebee Arrived onsite to find panel in alarm with pump DH507297 not running. Manual run would not engage the pump. Initial meter readings showed both switches closed and an old control bracket. No shorts to ground. Pulled pump to evaluate further. Both switches had moderate corrosion and the on/off switch tabs broke off immediately upon opening the sensor housing. Replaced both switches with dry packets enclosed. Opened up the motor control housing and replaced the control bracket with an MCB. Opened the suction housing to inspect the stator and found it to be slightly worn with rubber on the rotor. Cleaned rotor and put in a new stator. Put pump back into station cycled pump through alarm and off Pump pumped out of alarm in under 3 minutes and out of normal operation in under 40 seconds. Pump operating properly at 237 volts and 6.2 amps.			

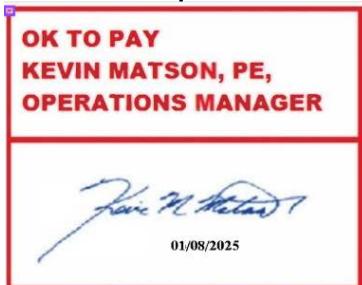

	Subtotal
	Sales Tax (0.0%)
	Total
	Payments/Credits
	Total Due

Site Specific Design, Inc.

1704 Rockwell Road
Abington, PA 19001



Invoice

215-887-3730

Date	Invoice #
12/16/2025	83869

Bill To
Upper Providence Township Attn: Kevin Matson, Sewer Authority 935 N. Providence Road Media, PA 19063

Ship To
Upper Providence Township 935 N Providence Road 610-566-5376 Media, PA 19063

Cust. PO #	Terms	Rep	Ship Date	Ship Via	Project
	Net 30	BB	12/16/2025		
Qty	Item Code	Description		Price Each	Amount
1	Service/Ins	*new duct seal around worn conduit opening			
2	Labor-BB	12/16/25 pat Arrived on site to give Bryan a hand pump was repaired installed back into station pump is operating correctly.I Helped clean up job completed.			
1	7290	Service Call & Inspection Fee Labor rate for Bryan Beebee PRESSURE SWITCH ON/OFF EXTREME w/O-rings NB0083G01		170.00 130.00 76.60	170.00 260.00 76.60
1	7291	PRESSURE SWITCH, ALARM EXTREME w/ O-rings NB0083G02		76.60	76.60
1	1265	CONTROL BRACKET ASM, 240V/60HZ ND0045G01		283.88	283.88
1	8203	STATOR/LINER ASSY EXTREME NC0039G01		103.76	103.76
1	Consumables	Includes nuts, bolts, washers, glue, tape, wire nuts, terminal flags, pipe dope, teflon tape, locktite, lubricants		27.05	27.05
				Subtotal	\$997.89
				Sales Tax (0.0%)	\$0.00
				Total	\$997.89
				Payments/Credits	\$0.00
				Total Due	\$997.89

Returned checks will incur a \$25.00 surcharge. If at any time your account runs past due, all shipments may be held pending.