

**KBX Golden**

439 McFarlan Road  
 Kennett Square, PA 19348  
 (610) 444-3551  
 CustomerService@KBXGolden.com  
 www.KBXGolden.com

**OK TO PAY  
 UPTSA - KMM**


**10/10/2023**

**KBX**  
**GOLDEN**

**INVOICE**

**BILL TO**  
 Upper Providence Township Sewer Authority  
 935 N. Providence Road  
 Media, PA 19063

**INVOICE** 20226440  
**DATE** 09/30/2023  
**TERMS** Net 30  
**DUUE DATE** 10/30/2023

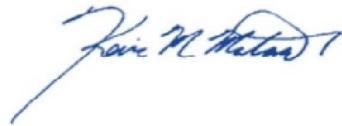

DATE	SERVICE	QTY	RATE	AMOUNT
	15 - Operations & Maintenance Monthly Operations and Maintenance of Pump Stations	1	5,360.69	5,360.69
MONTH OF SEPTEMBER				
Subtotal: 5,360.69				
	BORTONDALE			
09/05/2023	22 - Premium Time Mechanic Foreman Responded to high level alarm. Upon arrival found side #1 low level pump dome cracked. High head sonic start had rags on it. High head wire box had fallen off the back of pump, and light bulb had fallen out. Reinstalled light bulb. Put box back on and cleaned sonic start and installed new dome.	4	139.29	557.16
09/05/2023	Job Materials Dome		50.30	50.30
09/14/2023	22 - Premium Time Mechanic Foreman Respond to high water alarm. Upon arrival station operating level was normal. Observed proper operation before departure.	4	139.29	557.16
09/17/2023	22 - Premium Time Mechanic Foreman Responded to high level alarm. All ok upon arrival. Observed proper operation before departure	4	139.29	557.16
09/20/2023	22 - Premium Time Mechanic Foreman Responded to high level alarm. Upon arrival found side #1 not priming. Reeds were bent in vacuum pump. Bent reeds back to normal. Pump then primed up. Observed proper operation before departure.	4	139.29	557.16
09/20/2023	22 - Premium Time Mechanic Foreman Responded to lag alarm. Observed pumps operate properly. Reason for alarm unknown.	4	139.29	557.16
09/27/2023	22 - Premium Time Mechanic Foreman Responded to high water alarm. Level was normal upon arrival. Observed proper operation before departure.	4	139.29	557.16
09/28/2023	22 - Premium Time Mechanic Foreman Responded to high water alarm. Upon arrival found side #1 tripped. Reset. Lower pump might be bad, will need to be evaluated. Observed proper operation before departure.	4	139.29	557.16
09/29/2023	02 - Mechanic Foreman Tested Godwin pumps. Trouble shot side #1. Found the low pump shorted to ground. Side #2 had broken off bolts under volute. Pulled volute, removed broken bolts and repaired.	8	92.85	742.80

09/29/2023	01 - Mechanic	6	86.09	516.54
09/29/2023	01 - Mechanic	6	86.09	516.54
09/29/2023	04 - Vacuum Truck and Operator On site for repairs to pump station.	4	188.79	755.16
09/29/2023	04 - Vacuum Truck and Operator On site for repairs to pump station.	2	188.79	377.58
09/29/2023	Job Materials Volute Gaskets and Bolts		238.30	238.30
				Subtotal: 7,097.34
	VALLEY VIEW			
09/05/2023	02 - Mechanic Foreman Cleaned priming system on both pumps.	3	92.85	278.55
09/22/2023	02 - Mechanic Foreman Exercised generator. Tried to exercise transfer switch, however, it did not switch over.	3	92.85	278.55
09/22/2023	22 - Premium Time Mechanic Foreman Met with Premium Power to evaluate generator.	2	139.29	278.58
09/22/2023	Custom Service Transfer Switch Repairs		1,028.40	1,028.40
				Subtotal: 1,864.08
	ROSE TREE PARK			
09/08/2023	02 - Mechanic Foreman Troubleshoot issues with the dialer. Determined that the dialer is stuck in call out mode.	2	92.85	185.70
				Subtotal: 185.70
	GENERAL COLLECTION			
09/07/2023	02 - Mechanic Foreman Evaluated broken low pressure sewer main, located at 505 South Orange Street. Repair had been made by contractor on site. Took photos and reported.	3	92.85	278.55
09/22/2023	Sanitary Sewer Cleaning Crew Quarterly Cleaning at Famum and Crum Creek.	3	231.86	695.58
09/22/2023	10 - Traffic Control Crew	3	168.53	505.59
09/22/2023	04 - Vacuum Truck and Operator	4	188.79	755.16
09/22/2023	11 - Wastewater Disposal Fee Disposed of 700 gallons.	700	0.08	56.00
				Subtotal: 2,290.88

BALANCE DUE

**\$16,798.69**